

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1234	Street Main St.	City Anytown CA	Zip 98765	Date of Inspection 09/24/2007	Number of Pages Page 1 of 11
----------------------	--------------------	--------------------	--------------	----------------------------------	---------------------------------



On- Site Inspections, Inc.  
461 Alta Vista Dr.  
South San Francisco, Ca. 94080  
650 520-6953  
650 952-5173

A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. ANY QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER.

**Registration #** PR-5244

**Report #** 0003898

Ordered By: Report Sample C/O Steve Rush 1234 Main St. Anytown, CA	Property Owner and/or Party of Interest: Report Sample C/O Steve Rush 1234 Main St. Anytown, CA	Report sent to: Report Sample C/O Steve Rush 1234 Main St. Anytown, CA
--	---	--

COMPLETE REPORT 
 LIMITED REPORT 
 SUPPLEMENTAL REPORT 
 REINSPECTION REPORT


General Description: Two Story, Single Family Residence	Inspection Tag Posted: Garage
	Other Tags Posted: None Noted

An Inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

**Subterranean Termites** 
**Drywood Termites** 
**Fungus / Dryrot** 
**Other Findings** 
**Further Inspection**

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

**Key:** 1 = Substructure 2 = Stall Shower 3 = Foundation 4 = Porches/ Steps 5 = Ventilation  
6 = Abutments 7= Attic 8 = Garage 9 = Decks/ Patios 10 = Interior 11 = Exterior

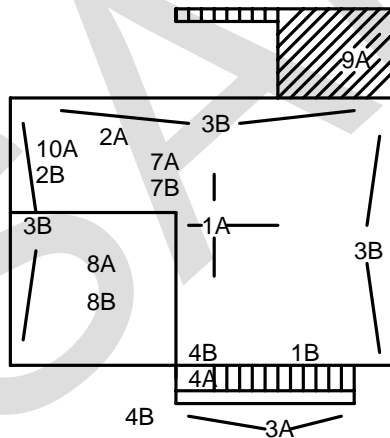

**Note:** Diagram Not to Scale

**Inspected By:** Steve Rush
**State License No.** OPR-10066
**Signature**

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 1418 Howe Avenue, Suite 18, Sacramento, California 95825-3204.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916)561-8708, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov). 43M-41 (REV. 10/01)

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1234	Main St.	Anytown CA	98765	09/24/2007	Page 2 of 11

### **IMPORTANT INFORMATION ABOUT STRUCTURAL PEST CONTROL INSPECTIONS, PLEASE READ CAREFULLY.**

Although the State of California regulates structural pest control firms, it does not require a Wood Destroying Pests and Organisms Inspection Report prior to the sale of property. However, prior to lending money on a property, a financial institution usually requires an inspection report to ensure that the building is structurally sound. This requirement protects its investment and provides the home buyer with an inexpensive safeguard against the cost of structural pest control repair and treatment. A buyer is advised to arrange for a structural pest control inspection regardless of the condition of the home at the time of sale. The cost of an inspection is minimal compared to the cost of repairing undetected pest damage that could cost thousands of dollars.

When a structural pest control company is hired, it is accountable to both the buyer and seller, regardless of who pays for the inspection. It is required to furnish the person who ordered the inspection with a copy of the report within ten working days. Under Section 1099 of the Civil Code, the seller usually delivers copies of the inspection reports to the buyer. Copies can also be obtained through escrow.

If there is any question about the report(s), the buyer should contact the company that made the inspection and/or performed the work. It is always advisable for buyers to order their own inspections.

The Structural Pest Control Act requires that all structural pest control companies in California use a standardized inspection report form. The inspection report should include any wood-destroying pests (such as termites or wood-boring beetles), fungus, and the resulting structural damage that is visible and accessible on the date of inspection. Conditions considered likely to lead to future wood-destroying pest infestations or infections such as excessive moisture, earth-to-wood contact, and faulty grade levels are also identified on the report. Recommendations are also made for treatment or repair.

A diagram on the inspection report must detail every part of the house checked for signs of infestation or infections. The report must also state which areas have been inspected and which areas have not been inspected because of inaccessibility. It is important to make sure the inspector understands what structures you want inspected and to be sure these areas were inspected. Outbuildings are generally not inspected unless requested. If you did not order the report, be sure to check if it is a limited or a complete report before accepting it. For real estate transfers, a complete structural pest inspection report is preferable.

Areas that cannot be inspected without opening the structure or removing the objects blocking the opening are considered inaccessible. Attics or subareas without adequate crawl space, slab foundations without openings to bathroom plumbing, floors covered by carpeting, wall interiors, and locked storage areas are the most common.

The pest control inspector must list all inaccessible areas and the specific reasons why they were not inspected. Careful attention should be paid to these areas, since there may be structural pest problems which cannot be detected without further inspection. The report will recommend whether or not further inspection is appropriate.

There is no law requiring that any recommendations listed on a report must be completed. However, many financial institutions require that both the inspection and all recommendations be completed prior to the close of escrow. The lender usually requires certification from a pest control company stating that the structure is free of infestation or infection. Some financial institutions may only be interested in determining whether recommendations for correcting active infestations and infections and the resulting damage (Section 1 items) have been completed. Lenders such as FHA and VA may require conditions that are present which could lead to an infestation or infection (Section 2 items) to be completed also.

A consumer may request a report from the pest control company which designates each item as either a Section 1, Section 2, or unknown for further inspection. Whether the buyer or seller pays for the work depends on the contract. The buyer should be aware of any recommendations which have not been completed before purchasing the home.

Structural pest control companies are required to complete a Notice of Work Completed and Not Completed when any work is done on a structure. Review all reports carefully for any indications that work has not been performed. The certification can be found on an inspection report, completion notice, or on the company's letterhead (see question eight for more certification information). The certification may include disclosures in situations where all of the recommended work has not been completed. The inspection report and the completion notice should be delivered to the person who ordered the report and to the property owner, or the agent, within ten working days.

Under the Structural Pest Control Act, there is a two-year statute of limitations on all inspection reports and completion notices. This means all complaints against licensees must be filed with the Board within two years after the date of inspection or completion of recommendations. Companies are not responsible for conditions which develop or become visible after the date of inspection. For that reason, it is advisable for a buyer to obtain an inspection report as close as possible to the close of escrow. If the seller orders the report, it is advisable to obtain it when the house is listed so that repairs may be completed before the start of escrow.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1234	Street Main St.	City Anytown CA	Zip 98765	Date of Inspection 09/24/2007	Number of Pages Page 3 of 11
----------------------	--------------------	--------------------	--------------	----------------------------------	---------------------------------

A structural pest control company is required to certify its inspection and/or work if requested by the person ordering the report. They will certify that either: 1) the inspection disclosed no evidence of active infestation or infection by wood-destroying pests or organisms in the visible and accessible areas; 2) the inspection disclosed active infestation or infection in visible and accessible areas which have been corrected; or 3) the property is free of pest infestation or infection in the visible and accessible areas, except for specified areas indicated. In cases where a structure is fumigated, the fumigation company will issue a certification of fumigation within five days after completing the fumigation. Every completion report should be compared with a copy of the inspection report to determine if there are any conditions which have not been corrected or if secondary, substandard corrections have been performed.

Consumers are never required to do business with the pest control company they hire to inspect. However, if a bid or estimate is given for corrective measures by that original company and the owner hires another party to perform its corrective measures, that original company must return and reinspect the property before issuing a certification.

Pest control companies will not certify chemical treatments performed by other pest control companies. The pest control company can perform an inspection of items called on its original inspection report within four months of the inspection. The reinspection should be completed within ten working days after it has been ordered. If more than four months have elapsed since the original report date, a full inspection of the structure(s) inspected on the initial report must be performed, and an original inspection report must be issued.

The report and any contract entered into will state specifically when any guarantee for the work is made and the specific terms of that guarantee.

Every time a structural pest control company makes an inspection for wood-destroying pests or organisms, it must post a tag in the attic, subarea, garage or other area specified in the front cover of the report. The tag contains the firm's name and the date of the inspection. A similar tag must be posted next to the inspection tag when the company completes any work. In addition to the firm's name and the date of the completion, this tag must indicate any pesticides used.

The structural pest control company must also note on an inspection report the location of the inspection tag as well as the presence of any other inspection tag or completion tag that is less than two years old. These reports are maintained by the pest control company for three years. You can contact the Structural Pest Control Board for verification of a license and/or company registration and complaint history.

You may also get the information at the Board's Website at: [www.pestboard.ca.gov](http://www.pestboard.ca.gov)

If you are unhappy with the service you received, call the company and discuss your concerns. If the company does not resolve the problem to your satisfaction, you can contact the Structural Pest Control Board for additional information or assistance by telephoning:

(916) 561-8708 - in Sacramento

(800) 737-8188 Ext. 2

- outside Sacramento Or by writing to:

Structural Pest Control Board Complaint Unit 1418 Howe Avenue, Suite 18 Sacramento, CA 95825-3204

The Board will first try to mediate your complaint. If this does not result in a satisfactory solution, the Board will make a determination on the responsibility of the company. The Board can compel the registered company or licensee to correct violations, but the Board does not have jurisdiction over monetary matters. If you seek a monetary settlement, you may want to consider taking legal action, since the Board cannot guarantee that you will receive any restitution.

The Board regulates all persons who perform structural pest control work by issuing licenses and bringing disciplinary action against licensees who fail to comply with the Structural Pest Control Act.

**"NOTICE" Owner/agent/tenant acknowledges and agrees that inspection of the premises will not include any type of inspection for the presence or non-presence of toxic molds and that this report will not include any findings or opinions regarding the presence or non-presence of toxic molds airborne or stationary in, upon, or about the premises. We recommend that you contact a contractor specifically licensed to engage in toxic molds related work. Furthermore, should our inspection of the premises cause a release of toxic molds, owner/agent/tenant shall be solely responsible for the clean up removal and disposal of the toxic molds and the cost thereof. Owner/agent/tenant hereby agrees to waive any and all claims against this company which are in any way related to the presence of toxic molds on the premises and further agrees to indemnify and hold this company harmless from any and all claims of any nature asserted by any third party, including this company's employees, which is in any way related to the presence of toxic molds on the premises.**

**"NOTICE:** The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board."

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1234	Street Main St.	City Anytown CA	Zip 98765	Date of Inspection 09/24/2007	Number of Pages Page 4 of 11
----------------------	--------------------	--------------------	--------------	----------------------------------	---------------------------------

**"NOTICE:** Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.) However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company."

**"NOTICE:** Under no circumstances should this wood destroying pest and organisms inspection report be construed as a guarantee and/or warranty of the structure(s). Inspection reports are intended to disclose infestations, infections and/or conducive conditions which are noted on the date of the inspection in the visible and accessible areas only as required by the Structural Pest Control Act. Any infestation, infections and/or conducive condition which are found after the date of inspection by any other person(s) will require an additional inspection report with findings, recommendations, and estimates.

**"NOTICE:** Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These include, but are not limited to: inaccessible and/or insulated attics or portions thereof, attics with less than 18" clear crawl space, the interior of hollow walls; spaces between a floor or porch deck and the ceiling or soffit below, stall showers over finished ceilings; such structural segments as porte cocheres, enclosed bay windows, buttresses, and similar areas to which there is no access without defacing or tearing out lumber, masonry or finished work: built in cabinetry; floors beneath coverings; floors over concrete; areas behind stoves, refrigerators or beneath floor coverings; furnishings; areas where encumbrances and storage; conditions or locks make inspection impractical, portions of the subarea concealed or made inaccessible by ducting or insulation, areas concealed by heavy vegetation, second story eaves, windows, doors siding trim, decks, balconies and other components over 11' from the ground requiring a ladder or extension pole.

**"NOTICE:** This is a separated report which defines as **Section 1** or **Section 2**, conditions evident on the date of inspection.

**Section 1** contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation or infection.

**Section 2** items are conditions deemed likely to lead to infestation or infection, but where no visible evidence of such was found.

**Further Inspection** items are defined as recommendations to inspect areas which during the original inspection, did not allow the inspector to complete the inspection and cannot be defined as Section 1 or Section 2.

**"NOTICE:** Client/ Buyer/ Purchaser agrees to read the entire written report when it is received and promptly call Inspector with any questions or concerns regarding the inspection or the written report. The written report shall be the final and exclusive findings of Inspector. Differences of opinion, repair techniques or additional findings can affect the purchase or selling decision. Client/ Buyer/ Purchaser acknowledges that further investigation by another independent Branch III Pest Control operator may provide additional information. In the event Client becomes aware of a reportable condition which was not reported by Company, Client agrees to promptly notify Company and allow Company and/or Company's designated representative(s) to inspect said condition(s) prior to making any repair, alteration, replacement or removal of investigative contingencies. On-Site Inspections, Inc. retains the right to correct or repair any condition or finding we may be responsible for. Client/ Buyer/ Purchaser agrees that any failure to so notify Company is a material breach and will relieve On-Site Inspections, Inc., its employees or officers from any liability or future responsibility. All parties are strongly advised to contact our Company during normal business hours (8am-5pm, Monday - Friday) with and questions or concerns they may have in relation to this report issued. 650 952-5173.

**"NOTICE:** During the course of opening walls or any previously concealed areas, should any further damage or infestation be found, a supplemental report will be issued. Any work completed in these areas would be at owners direction and at additional expense.

**"NOTICE;** Any statements made in the body of this inspection report pertaining to left, right, front or rear are referenced to standing in front of and facing the building from the front door.

### **1-SUBSTRUCTURE**

**1A-** This building is built over a concrete slab and does not incorporate the use of a crawlspace; therefore no representations can be made to conditions under the slab.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1234	Main St.	Anytown CA	98765	09/24/2007	Page 5 of 11

NOTE: It is common in slab construction for subterranean termites to enter the structure from below the slab through inaccessible areas such as cracks in the slab. In carpeted areas or other floor coverings over the slab, it is impossible to detect these cracks. This company takes no responsibility for any subterranean termite infestations or damage in any of these inaccessible areas. If requested this company will return to remove carpets or floor coverings for additional fees and inspect for additional charges.

**1B- FINDING:** Evidence of subterranean termites found in the subarea under entry stairs.

**RECOMMENDATION:** Chemically treat with a registered termiticide adjacent to foundation and drill into enclosed walls to control subterranean termites. Remove all shelter tubes.

SECTION I ITEM.

ESTIMATED COST: \$ 2175

### 2-STALL SHOWERS/TUB ENCLOSURES

**2A-** The shower stall in the lower bathroom was given a standard water test in accordance with Structural Pest Control Board Rules and Regulations. No leakage was evident at the time of inspection. The homeowner is advised to maintain this watertight condition by periodically sealing the shower surround as part of normal routine maintenance.

**2B-** The tub enclosure was inspected and found to be free of leaks and conditions conducive to moisture penetration. Keeping all areas well sealed with grout and/ or caulking as applicable is advised as part of a routine maintenance schedule

### 3-FOUNDATION

**3A- FINDING:** The soil in the attached planter at the front is above the foundation height creating a faulty grade condition.

**RECOMMENDATION:** Lowering the soil in the planter is advised, if practical. Other modifications to the planter such as removal may be necessary.

SECTION II ITEM

OTHER TRADES

NOTE: Planters require a 2" separation between the planter and the structure.

**3B- FINDING:** The foundation stem walls in the converted basement are enclosed for the most part. The foundation is inaccessible for inspection. No representations can be made.

UNKNOWN, FURTHER INSPECTION ITEM

### 4-PORCHES STEPS

**4A-** The entry porch is masonry over wood framing with a waterproof membrane separating the wood from the masonry. The masonry capping is subject to hairline cracks or improper flashing that may allow moisture penetration.

**RECOMMENDATION:** Monitoring the underside for signs of moisture staining and periodic sealing of cracks is recommended.

SECTION II ITEM

**4B- FINDING:** The framing under the entry porch is enclosed and not visible for inspection. No representations can be made to areas not visible for inspection.

**RECOMMENDATION:** If further information is required for this area, the enclosed areas should be opened to provide access for inspection.

UNKNOWN, FURTHER INSPECTION ITEM

### 5-VENTILATION

The attic ventilation appeared to be adequate.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1234	Street Main St.	City Anytown CA	Zip 98765	Date of Inspection 09/24/2007	Number of Pages Page 6 of 11
----------------------	--------------------	--------------------	--------------	----------------------------------	---------------------------------

### 7-ATTICS

**7A- FINDING:** Evidence of drywood termites (Kalotermes) found in attic area.

**RECOMMENDATION:** Tarp, seal and fumigate with the lethal gas, Vikane.

SECTION I ITEM.

ESTIMATED COST: \$ 2900

**7B- Structural Pest Control requirements are to remove all visible evidence of drywood termites after treatment to prevent any future mis-diagnosis. This is not a fumigation company responsibility.**

**RECOMMENDATION:** Remove or cover drywood termite pellets.

SECTION 1

ESTIMATED COST: \$ 195

### 8-GARAGE

**8A- All or part of the garage wall framing was enclosed and not available to inspect. No representations can be made.**

**8B- FINDING:** There was stored personal property in the garage and we were unable to fully inspect the interior of the garage.

**RECOMMENDATION:** When the stored property is removed, we will finish inspecting in the garage.

UNKNOWN, FURTHER INSPECTION ITEM

### 9-DECKS AND PATIOS

**9A- FINDING:** The redwood decking at the rear is fungus damaged.

**RECOMMENDATION:** Remove and replace all damaged decking.

SECTION I ITEM.

ESTIMATED COST: \$ 2490

### 10-INTERIOR

**10A- A wooden floor is constructed over a concrete slab in the lower bathroom. The underside of the floor was inaccessible for inspection due to inadequate clearance between the wood members and concrete floor. The top side of the floor was inspected and no visible signs of infestations or infections were found. If interested parties request, we will cut an opening to enable further inspection. Upon request, we will issue a supplemental report with findings and recommendations with charges, if any.**

UNKNOWN, FURTHER INSPECTION

### 11-EXTERIOR

**11A- FINDING:** Exterior stucco extends below exterior grade. This condition could conceal and contribute to termite infestation and/or fungus infection.

**RECOMMENDATION:** Further inspection. If requested, after concealed areas have been exposed by others, we will return to inspect these areas.

UNKNOWN, FURTHER INSPECTION ITEM.

**11B- FINDING:** The second story eaves were not inspected due to their height.

**RECOMMENDATION:** Further inspection. If the owner desires for these areas to be inspected, we will return with a long enough ladder to inspect eaves, at an additional reinspection fee. This company assumes no responsibility for any infestations or infections in the areas without making a further inspection.

UNKNOWN, FURTHER INSPECTION ITEM.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1234	Street Main St.	City Anytown CA	Zip 98765	Date of Inspection 09/24/2007	Number of Pages Page 7 of 11
----------------------	--------------------	--------------------	--------------	----------------------------------	---------------------------------

### OCCUPANT NOTES:

When a fumigation is recommended, we will exercise all due care, but assume no responsibility for damage to shrubs, trees, plants, TV antennas or roofs. An Occupant's Fumigation Notice and Disclaimer will be provided to the owner of the property or his/her designated agent. Occupant must comply with instructions contained in the Occupant's Fumigation Notice and Disclaimer. During fumigation and aeration, the possibility of burglary exists as it does any time you leave your home. Therefore, we recommend that you contact your insurance agent and verify that you have insurance coverage to protect against any loss, damage, or vandalism to your property. The company does not provide any on-site security except as required by state or local ordinance and does not assume any responsibility for care and custody of the property in case of vandalism, breaking or entering.

1. Occupant's Fumigation Notice must be signed prior to fumigation.
2. Access to the property and electrical power must be available.
3. The property will need to be vacated for 3 days and 2 nights to complete the fumigation process.

### HOW BUILDINGS ARE FUMIGATED

Vikane is a gas, prior to fumigation the structure is completely sealed. This serves to contain Vikane in the building so it can penetrate wood thoroughly and eliminate the pests. Depending on the construction of the building, the doors and windows may be sealed with tape and a plastic sheet, or the structure may be covered with a tarp. The building will remain sealed for 4-72 hours depending on the specifics of the job. Warning signs are posted around the building notifying people to keep out.

After the tarp or tape is removed, a professional fumigator will aerate the structure by opening the doors and windows. Fans may also be used to clear out the building. Once the dwelling has been thoroughly aerated, the fumigator is required to measure the level of any fumigant remaining in the living space to ensure it is below the EPA approved concentration for reentry by the occupants. Extremely low levels of fumigant can remain for a short period of time in dead air spaces between walls and inside cabinets as well as porous materials such as furniture. The small amount of fumigant in these areas will continue to dissipate for a few hours after the fumigation but at levels well below the established safe reentry concentration. Your building should not be cleared for reoccupancy until it is safe to enter. The fumigator will post a notice on your building indicating the day and time for reentry. Structures can be occupied only when the concentration is 5 parts per million or less (this represents a margin of safety - laboratory animals have been exposed to 100 parts per million for 2 weeks with no adverse effects.) Because Vikane is a true gas and not a vapor, aeration is rapid. Recent studies demonstrated that in most structures levels are less than 1 part per million within 6 hours of clearing and have no detectable levels of Vikane within 24 hours after the start of aeration.

Sulfural fluoride is a colorless, odorless gas, so a warning agent is added to the building which causes watery eyes and a scratchy throat. If you experience these symptoms in a structure that has been recently fumigated, you should leave immediately and call the pest control company to have your building retested.

### SULFURYL FLUORIDE (POTENTIAL HEALTH RISKS FROM OVEREXPOSURE)

Sulfural fluoride is a gas and can potentially enter your body only through inhalation. Because it is a gas, it does not stay on dry surfaces, therefore, there is no exposure from touching treated surfaces.

Nervous system and respiratory irritation:

Overexposure to high levels of Sulfural fluoride can result in nose and throat irritation and nausea. At high concentrations (such as those used during the fumigation) it can cause excess fluid in the lungs, sleepiness, pneumonia, and convulsions. These symptoms would be expected to appear within 8 hours after such an exposure. In the unlikely event you experience these symptoms in a building that has been recently fumigated, you should leave immediately. Consult your physician and call the pest control company to have your building retested.

Additional studies:

Sulfural fluoride has not been shown to cause birth defects in pregnant animals exposed under experimental conditions. In addition, current studies have demonstrated there are no mutagenic or genotoxic effects caused by exposure to Sulfural fluoride.

### Safety Precautions and Homeowner Preparation

- . Discuss the treatment program in advance with your pest control company so you fully understand what will be done and what you need to do.
- . Carefully follow the instructions you are given about what items you are to remove from your building.
- . Stay out of the treated building until it is cleared for reentry.

**WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT**

Building No. 1234	Street Main St.	City Anytown CA	Zip 98765	Date of Inspection 09/24/2007	Number of Pages Page 8 of 11
----------------------	--------------------	--------------------	--------------	----------------------------------	---------------------------------

. If you are interested or concerned, you should ask your pest control company to show the records of how your building was aerated before it was cleared to reentry.

. You may wish to increase ventilation by opening doors and windows.

Call Dow Elanco Customer Information Service at 1-800-352-6776 if you need additional information or have questions concerning the product.

\*Trademark of Dow Elanco

SAMPLE



**WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT**

<b>Building No.</b> 1234	<b>Street</b> Main St.	<b>City</b> Anytown CA	<b>Zip</b> 98765	<b>Date of inspection</b> 09/24/2007	<b>Number of Pages</b> Page 9 of 11
-----------------------------	---------------------------	---------------------------	---------------------	---	--

**"NOTICE TO OCCUPANT"**

**CHEMICAL INFORMATION, PLEASE READ CAREFULLY**

Our company has always strived to provide its customers with the safest and most efficient methods of pest control. Knowing that we deal with toxic materials, we keep ourselves educated so we can provide our customers with the best possible service results, and so we can use pesticides in the safest possible manner for our customers and ourselves. In accordance with our sense of responsibility for the safety of our customers and employees. State Law requires that you be given the following information:

**CAUTION -- PESTICIDES ARE TOXIC CHEMICALS**  
Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Food and Agriculture and the United States Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence there are no appreciable risks and/or the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. If within 24 hours following application, you experience symptoms similar to common seasonal illness or flu-like symptoms, contact your physician or poison control center and your pest control company immediately. For further information, please contact any of the following:

- On-Site Inspections - (650) 952-5173**
- Leading Edge Pest Management (925) 689-2222**
- Poison Control Center: (800) 764-7661**
- Structural Pest Control Board: (800) 737-8188**
- For Health Questions --** the County Health Department Alameda County (415)540-3063; Contra Costa County (415) 646-2286; San Francisco County (415)554-2500; San Joaquin County (209) 468-3420; San Mateo County (415) 363-4305; Santa Clara County (408) 299-6060.

For Application information - the County Agricultural Commissioner: Alameda County (415) 670-5156; Contra Costa County (415) 646-5250; San Francisco County (415) 285-5010; San Joaquin County (415) 468-3300; San Mateo County (415) 363-4700; Santa Clara County (408) 299-2171.

**For Regulatory Information -** the Structural Pest Control Board: (916)263-2544, 1418 Howe Avenue, Suite 18, Sacramento, CA 95825-3280.

Pesticides that may be used on your property to control the following pests and organisms during the course of our work is listed below. The active ingredients are also listed.

**Dampwood Termites**  
\_\_ TRIBUTE; Cyano (3-phenoxyphenyl) methyl 4-choloro-alpha (1-methylethyl)benzeneacetate. Contains 2 pounds of fenvalerate per undiluted gallon.

- Drywood Termites (Fumigation)**  
\_\_ **XX** VIKANE; Sulfural Fluoride with Chloropicrin as the warning agent.
- Drywood Termites (Local Treatment)**  
\_\_ CY-KICK; Cyfluthrin  
\_\_ TERMIDOR SC; Fipronil  
\_\_ DRIONE; Pyrethrins, Piperonyl Butoxide-Technical, Amorphous Silica Gel and Petroleum Distillate.  
\_\_ TRIBUTE; Cyano (3-phenoxyphenyl) methyl 4-choloro-alpha (1-methylethyl)benzeneacetate. Contains 2 pounds of fenvalerate per undiluted gallon.  
\_\_ TRI-DIE PT230; Pyrethrins, Piperonyl Butoxide-Technical, Silica Gel  
\_\_ FLEXAFOAM; Dihexyl sodium sulfosuccinate, Sodium-2ethyl-hexyl sulfate, Triethanolamine alkylaryl sulfonate, Dioctyl sulfosuccinate, sodium salt. Inert ingredients. constituents ineffective as a foaming adjuvant.  
\_\_ BORA-CARE; Disodium Octaborate Tetra Hydrate
- Fungus and/or Dryrot**  
\_\_ COPPER GREEN; Copper Napthenate, Copper salts of Naphthenic Acids  
\_\_ TIM-BOR; Disodium Octoborate Tetra Hydrate  
\_\_ BORA-CARE; Disodium Octaborate Tetra Hydrate  
\_\_ IMPEL RODS; Disodium Octaborate Tetra Hydrate
- Subterranean Termites**  
\_\_ **XX** PREMISE; Active ingredient, Imidacloprid 75%; 25% inert ingredients  
\_\_ TERMIDOR SC; Fipronil  
\_\_ TRIBUTE; Cyano (3-phenoxyphenyl) methyl 4-chloro-alpha-(1-methylethyl)benzeneacetate. Contains 2 pounds of fenvalerate per undiluted gallon.  
\_\_ FLEXAFOAM; Dihexyl sodium sulfosuccinate, Sodium-2ethyl-hexyl sulfate, Triethanolamine alkylaryl sulfonate, Dioctyl sulfosuccinate, sodium salt. Inert ingredient. constituents ineffective as a foaming adjuvant.  
\_\_ **XX** PROFOAM PLATINUM; principle function agents: Sulfates Disodium Lauroampho Diacetate Sulfactant blend  
\_\_ BORA-CARE; Disodium Octaborate Tetra Hydrate
- Wood Destroying Beetles (Fumigation)**  
\_\_ VIKANE; Sulfural Fluoride with Chloropicrin as the warning agent
- Wood Destroying Beetles (Local Treatment)**  
\_\_ PREMISE; Active ingredient, Imidacloprid 75%; 25% inert ingredients  
\_\_ TRI-DIE PT230; Pyrethrins, Piperonyl Butoxide-Technical, Silica Gel  
\_\_ TIM-BOR; Disodium Octoborate Tetra Hydrate  
\_\_ BORA-CARE; Disodium Octaborate Tetra Hydrate
- Carpenter Bees**  
\_\_ TRI-DIE PT230; Pyrethrins, Piperonyl Butoxide-Technical, Silica Gel
- Carpenter Ants**  
\_\_ TERMIDOR SC; Fipronil

**NO CHEMICAL APPLICATION WILL BE PERFORMED UNTIL SUCH TIME THAT THIS NOTICE IS SIGNED WHICH ACKNOWLEDGES RECEIPT OF THIS PESTICIDE DISCLOSURE NOTICE AS REQUIRED BY CALIFORNIA LAW (8538 BUSINESS AND PROFESSIONS CODE AND 1970.4 CALIFORNIA CODE OF REGULATIONS.) HAVING READ THE INSTRUCTIONS, I, THE UNDERSIGNED, WILL ACCEPT RESPONSIBILITY FOR ALL THE FOREMENTIONED. NOTE TO LANDLORDS: IT IS SPECIFICALLY YOUR RESPONSIBILITY PERSUANT TO CIVIL CODE 1940.8, RELATING TO LANDLORDS, TO PROVIDE THIS PESTICIDE DISCLOSURE NOTICE TO YOUR TENANTS(S) AND HAVE THEM SIGN A COPY TO BE RETURNED TO US PRIOR TO ANY CHEMICAL APPLICATION.**

\_\_\_\_\_  
OCCUPANTS OR OWNERS

\_\_\_\_\_  
DATE

\_\_\_\_\_  
PRINT NAME

\_\_\_\_\_  
UNIT# OWNER OR AGENT

\_\_\_\_\_  
DATE

\_\_\_\_\_  
PRINT NAME

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

<b>Building No.</b> 1234	<b>Street</b> Main St.	<b>City</b> Anytown CA	<b>Zip</b> 98765	<b>Date of inspection</b> 09/24/2007	<b>Number of Pages</b> Page 10 of 11
-----------------------------	---------------------------	---------------------------	---------------------	---	---



**On- Site Inspections, Inc.**  
 461 Alta Vista Dr. South San Francisco, Ca. 94080  
 Phone: 650 520-6953 Fax: 650 952-5173  
 Registration # PR-5244

### **WORK AUTHORIZATION CONTRACT** **(This is a binding contract, please read carefully)**

**Address of Property:** 1234 Main St.  
**City:** Anytown  
**State/Zip:** CA  
**Date of inspection:** 09/24/2007

No work will proceed until a signed copy of this agreement has been received. **If chemical treatments are to be performed, the "Notice to Occupant" chemical information page must be signed and returned with this contract** and becomes part of this agreement. On-Site Inspections, Inc. is authorized to proceed with the work outlined below or as specified on this agreement.

#### **TERMS OF PAYMENT**

We agree to pay the sum of \$ \_\_\_\_\_ upon completion of the repairs. Note: A 10% down payment is required upon acceptance of this contract on all repair work excluding chemical treatments. Progress payments of 25% to be paid upon progression of repair work until all work is completed at which time the final balance is due. All repair work to be performed in a good workmanship manner and consistent with applicable state and/or local codes.

If billing is through escrow, all payments due upon close of escrow. We instruct, \_\_\_\_\_ to pay the sum of \$ \_\_\_\_\_ upon close of escrow. Close of escrow date \_\_\_\_\_. We authorize this company to perform repairs to items \_\_\_\_\_ for a contract price of \$ \_\_\_\_\_.

We understand that we are responsible for payment. All payments are due regardless of billing method, no later than 10 days from completion of work and upon notification. Late fees of 1.2% will accrue every thirty days at an annual rate of 18% of the balance due until paid.

#### **Itemized Cost Breakdown (refer to items on report)**

Item#	Section I	Item#	Section II	Item#	Further Inspection
	<b>Primary Estimate</b>				
1B	\$ 2175	3A	<b>OTHER TRADES</b>	3B	
7A	2900	4A	<b>HOMEOWNER</b>	4B	
7B	195			8B	
9A	2490			10A	
				11A	
				11B	

**Total: \$ 7760**

#### **"NOTICE TO OWNER"**

Under the California Mechanics Lien Law, any structural pest control operator who contracts to do work for you, any contract, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for this work or supplies, has a right to enforce a claim against your property. This means that, after a court hearing, the court officer could sell your property, and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your own contractor in full, if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors, or material suppliers are required to provide you with a document entitled "Preliminary Notice." General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

**WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT**

Building No.	Street	City	Zip	Date of inspection	Number of Pages
1234	Main St.	Anytown CA	98765	09/24/2007	Page 11 of 11

**WORK AUTHORIZATION CONTRACT LIMITED CONDITIONS**

- This offer is limited to (4 ) four months from the date of the report.
- A minimum charge of \$150.00 will be charged for each reinspection, due at the time of the reinspection, when work is performed by others. When work is performed by others, a reinspection is required when walls and floors are open, if certification from this company is desired. Reinspection will be performed within four months of the date of the original inspection and may require as long as ten days to be made. This Company cannot reinspect and/or certify chemical applications performed by others unless subcontracted by Company.
- If, during the performance of any repairs, or reinspections, by this company, any infestations or infections are revealed that were not evident at the time of our original inspection, we would issue a supplemental report with findings, recommendations and additional costs for correction.
- PRICES QUOTED WITH THIS REPORT REFLECT OUR COMPANY COMPLETING ALL ITEMS LISTED. IF ONLY SELECTED ITEMS ARE COMPLETED BY OUR COMPANY, THE PRICES MAY VARY. WE GUARANTEE CHEMICAL TREATMENTS AND FUMIGATIONS DONE BY THIS COMPANY, OR SUBCONTRACTED, FOR ONE YEAR FROM THE DATE OF COMPLETION. WE GUARANTEE WATER DAMAGE REPAIRS FOR THIRTY (30) DAYS FROM THE DATE OF COMPLETION. WE CANNOT GUARANTEE WORK DONE BY THE OWNERS OR THE OWNERS AGENT. WE MAKE NO GUARANTEE AGAINST FUTURE INFECTIONS, ADVERSE CONDITIONS OR CONDITIONS PRESENT BUT NOT EVIDENT AT THE TIME OF OUR INSPECTION.
- We guarantee the work completed by this company, or subcontracted, for a period of ONE YEAR from the date of completion (unless otherwise stated in the body of this report), with the exception of plumbing, grouting, caulking, resetting of commodes, resetting of enclosures, or floor coverings, which are guaranteed for 30 days, as these are owner maintenance areas.
- WE RECOMMEND ALL ITEMS IN OUR REPORT BE COMPLETED. We assume no responsibility for infestations, infections or damage resulting from items not completed by this company. If repair work is performed by others, all guarantees, warranties, and permits should be obtained from the parties performing the repairs. Should the further inspection items noted in this report not be performed, our company will assume no liability for any infestations or infection which may be concealed in these areas.
- Our company does no texturing, painting, or wall papering. However, we will cover exterior wood work with one (1) coat of white primer.
- If a complete certification is desired from this company, all Section I items would have to be completed. It should be noted that this company does not do inspections on foundations as it is beyond the scope of our license.
- If a wood destroying pest or organism has caused damage directly resulted from the condition at the foundation then our report will indicate this otherwise it is recommended for further information regarding the foundation interested parties should contact appropriate trades.
- If damage is found to extend into any inaccessible areas, a supplemental report will be issued listing additional findings, recommendations, and bids.
- If a building permit is required by law, this company will obtain permits. The price for these permits is not included with our bid. Should the local building department require additional changes or repairs not outlined in this report, additional funds may be required. If a building permit is obtained, it will be the homeowner's responsibility to schedule the Final Inspection with the local building department.
- We will use due caution and diligence in our operations when performing repair work and care will always be taken to minimize any damage, but assume no responsibility for matching existing paint colors and styles, or for incidental damage to roof coverings, TV antennae, solar panels, rain gutters, plant life, paint or wall covering. There may be health related issues associated with the structural repairs reflected in the inspection report referenced by this authorization contract. These health issues include but are not limited to the possible release of mold spores during the course of repairs. We are not qualified to and do not render any opinion concerning such health issues or any special precautions. Any questions concerning health issues or any special precautions to be taken prior to or during the course of such repairs should be directed to a Certified Industrial Hygentist before any repairs are undertaken. By executing this work authorization contract, customer acknowledges that he or she has been advised of the foregoing and has the opportunity to consult with a qualified professional.
- We also assume no responsibility for pets harmed by repairs performed, by chemicals used or unintentionally released by our workers.
- This report is limited to the visually accessible areas of the structure inspected. Please refer to the report for areas not inspected and further information.

NAME OF PERSON TO CONTACT FOR ACCESS: \_\_\_\_\_ (please print) TEL.# \_\_\_\_\_

Signed \_\_\_\_\_ Date: \_\_\_\_\_

Owner or Authorized Agent \_\_\_\_\_ Date: \_\_\_\_\_

It is assumed that if an agent orders work on behalf of the owner, that they were notified prior by said agent, that is payment is not made by the agent or escrow company it will be the responsibility of the Owner to produce payment based on the terms outlined above.